
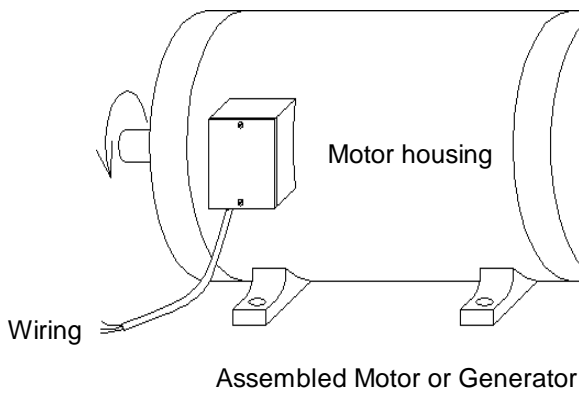


Simplified Drawing of a Motor or Generator (Exploded view)

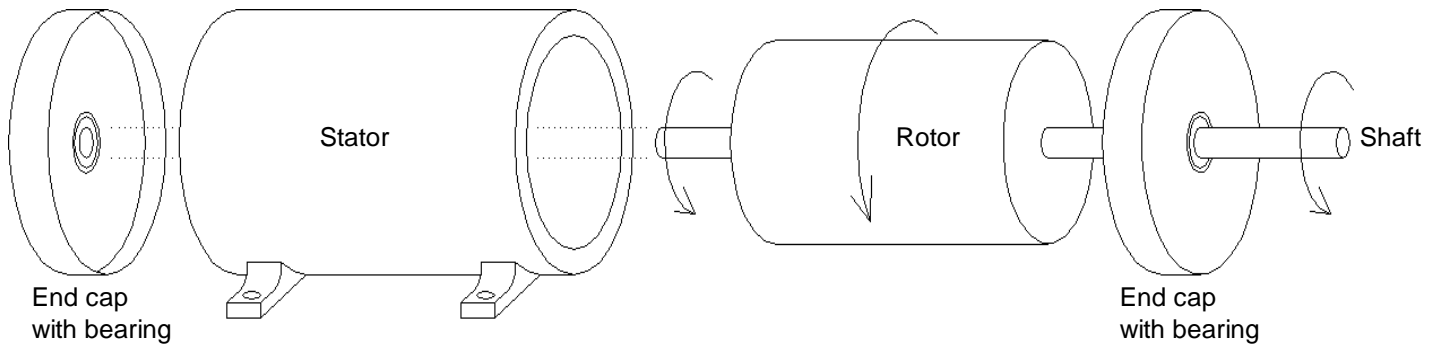

Torque T or τ , N·m


Angular Velocity ω , $\frac{\text{rad}}{\text{sec}}$ or n , $\frac{\text{rev}}{\text{min}}$ or rpm

Angular Acceleration α , $\frac{\text{rad}}{\text{sec}^2}$

Output power (mechanical) P_{shaft} or P_{out} W or hp (horse power)


The only way to get output power is to attach the motor shaft to a mechanical load.

$= \tau\omega$

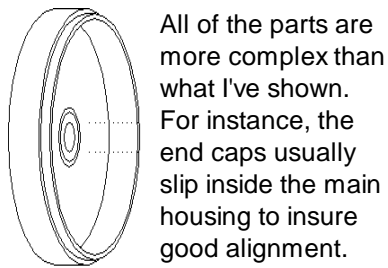


All of the parts are more complex than what I've shown. For instance, the end caps usually slip inside the main housing to insure good alignment.


Many drawings of motors, especially those designed to show how the motor works, show the motor from one end and only show the most important parts.

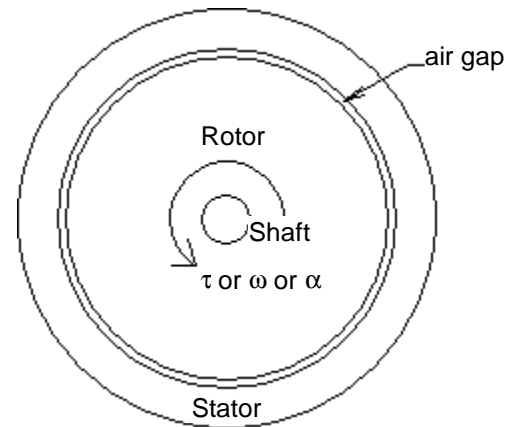


This is, of course, an electrical device, so it needs some wiring,

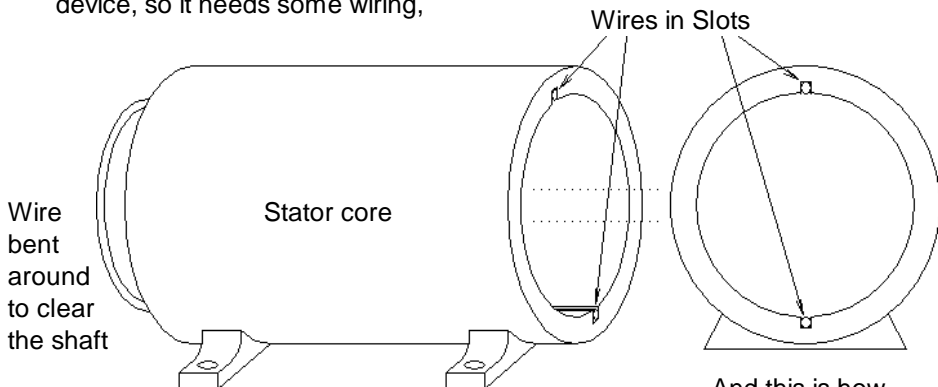


And this is how details will be shown

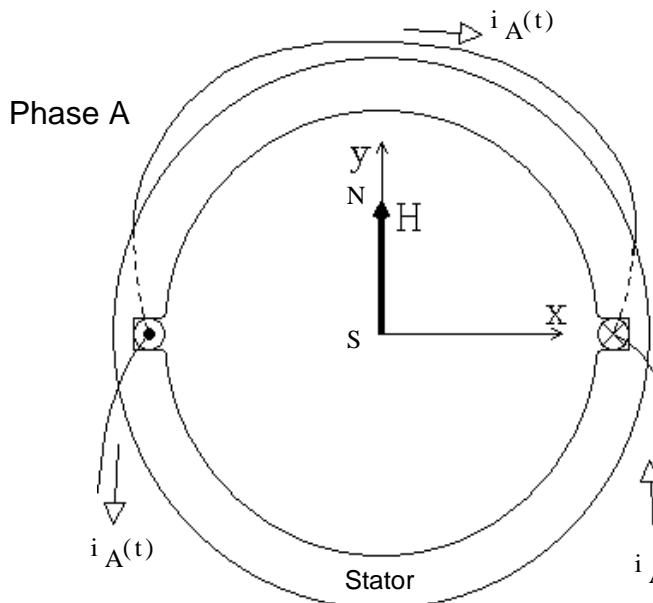


It is also an electromagnetic device
Establishing a Rotating Magnetic Field

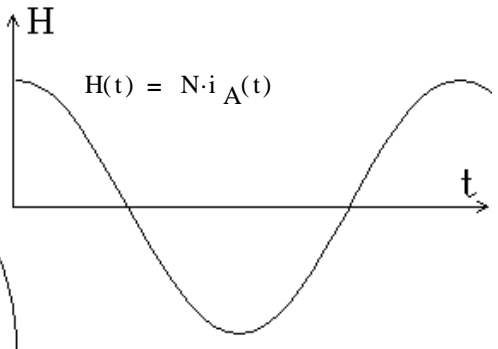



Field goes up and down, but no rotation

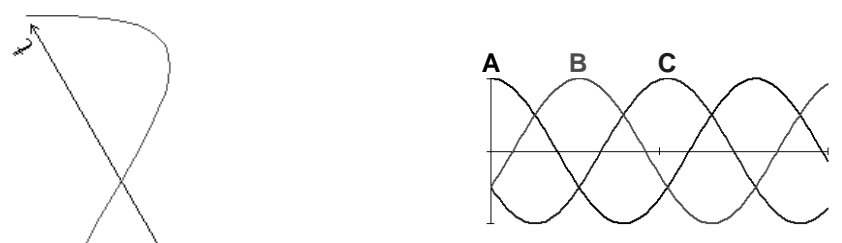


Phase B

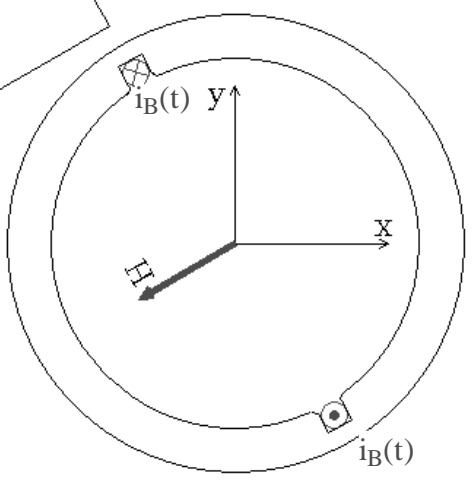

Phase C

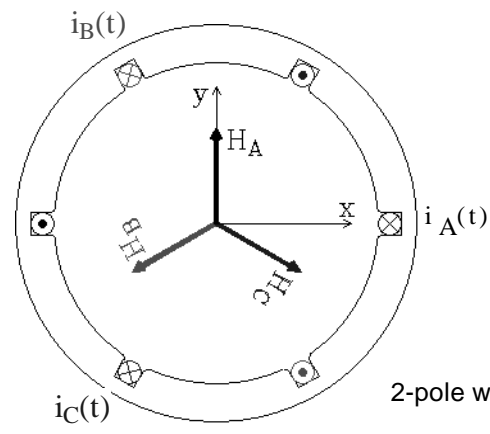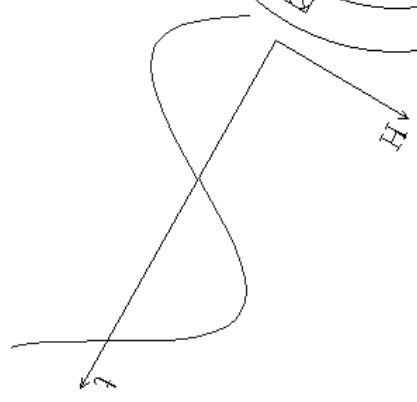

2-pole windings

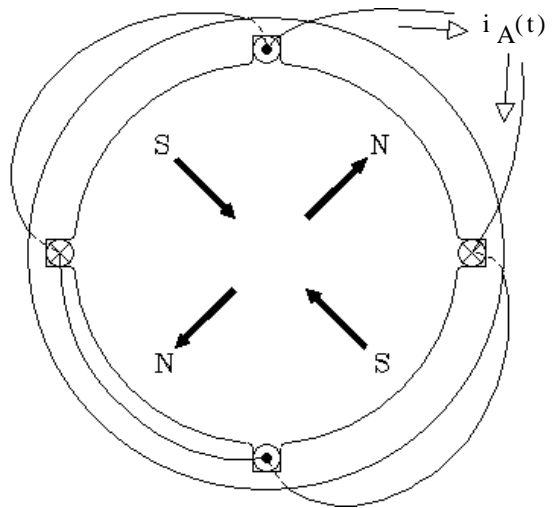

Phase A of a 4-pole winding

All 3 phases create a counterclockwise rotating magnetic field.


Speed of the Rotating Magnetic Field
 Depends on the number of poles $\omega = \frac{4 \cdot \pi \cdot f}{N_{\text{poles}}} = \frac{2 \cdot \left(377 \cdot \frac{\text{rad}}{\text{sec}} \right)}{N_{\text{poles}}}$ for 60Hz systems

OR, n_m or $n_{\text{sync}} = \frac{f \cdot \frac{2 \cdot \text{poles} \cdot 60 \cdot \text{sec}}{\text{cyc min}}}{N_{\text{poles}}} = \frac{7200 \cdot \text{rpm}}{N_{\text{poles}}}$ for 60Hz systems

The same stator windings are used for 3-phase Synchronous Machines and for Induction Motors. In Synchronous Machines the stator is often called the "armature".


Synchronous Generators & Motors

Rotor The rotors in Synchronous Machines are magnets which want to follow the rotating magnetic fields, usually DC electromagnets. The DC current usually flows through brushes and slip rings to reach the moving rotor. Sometimes the field current is generated and rectified right on the rotor. This DC field current is called the field current (I_f).

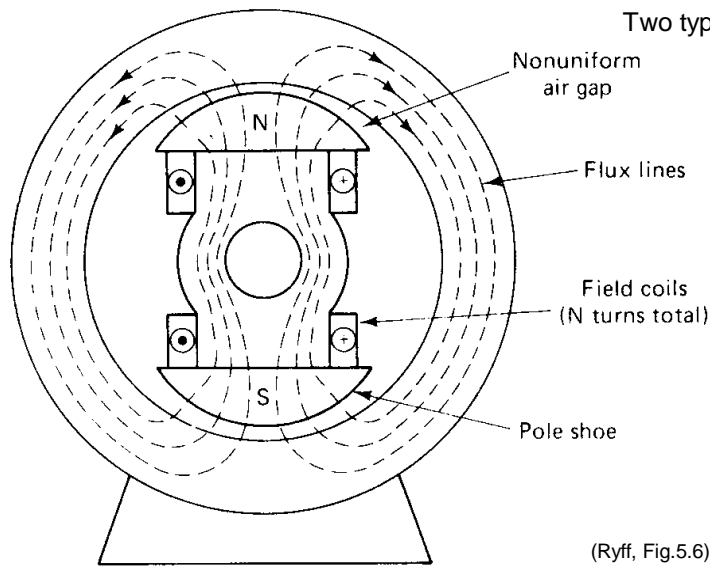


2 Salient poles

Common for a motor or generator with many poles

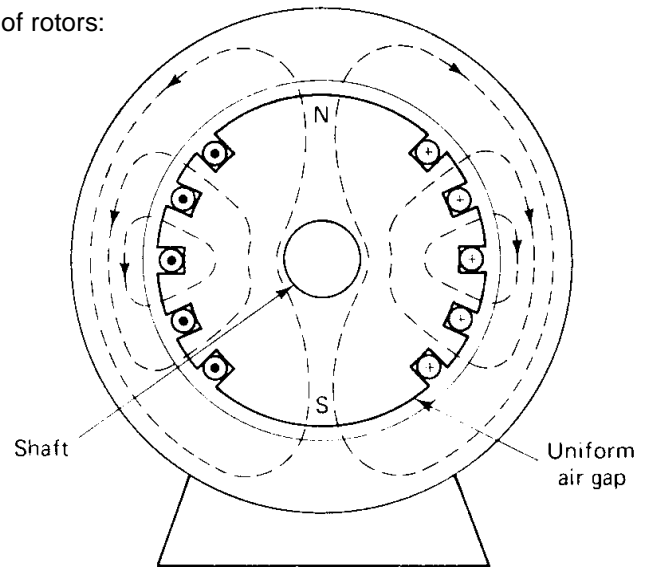


2 Non-salient poles, Cylindrical rotor

Common for a motor or generator with few poles

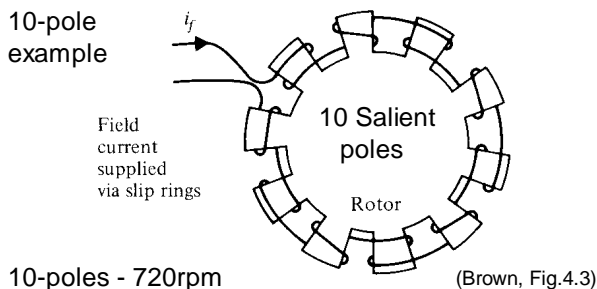

10-poles - 720rpm (fast for hydro) (Brown, Fig.4.3)

Typically low-speed motor or water turbine driven generator. Typically short in length and large in diameter. (typ diameter is 1.5xlength)

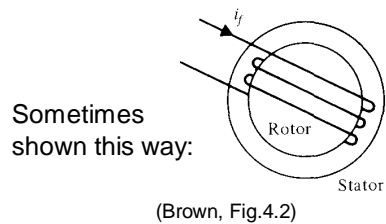

(Brown, Fig.4.2)

Typically high-speed motor or steam turbine driven generator, long and small diameter. (typ length is 3xdiameter)

2-poles - 3600rpm 4-poles - 1800rpm

Motor

If the stator currents flow in from a 3-phase power source and the rotor is a magnet, the rotor will follow the rotating magnetic field at the synchronous speed (in sync with the rotating field). That would be a synchronous motor. However, when the magnetic rotor is spinning within the stator windings it will induce voltages on those windings, just like a generator. The induced voltages (called the back EMF, E_A) will oppose the input voltages that caused the original currents to flow.


When the motor shaft is connected to a mechanical load (spins something which resists spinning), the rotor tries to slow down, but it only succeeds in lagging behind the rotating magnetic field a little (unless the motor is overloaded). When the rotor lags behind the field, the induced voltages (E_A)s will also lag the input voltages.

Generator


If, instead of a mechanical load, the shaft of this same device is connected to a source of mechanical power which tries to make it spin faster than the synchronous speed, it will act as a generator. If the generator is connected to the power grid (as they usually are) the only way the mechanical power source (the prime mover) can increase the speed would be to push the frequency of the entire grid higher than 60 Hz -- not likely. So all it succeeds in doing is to make the rotor lead the rotating magnetic field a little and along with it the induced voltages (E_A)s will also lead the grid voltages..

Phasor diagrams of one phase.

We usually consider the the terminal or phase voltage (V_ϕ) be set and held constant by the entire power grid.

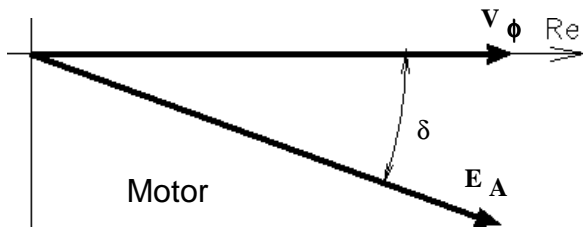


When operated as a motor, the induced armature voltage (E_A) lags the terminal voltage, V_ϕ .

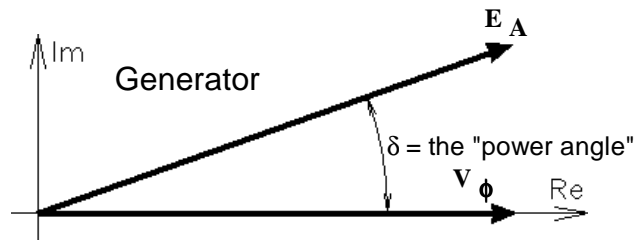


When operated as a generator, the induced armature voltage (E_A) leads the terminal voltage, V_ϕ .

The magnitude of the induced armature voltages (E_A for our phase) depends on the field current, I_f . I_f causes the field flux (called **excitation**). The DC current may come from an external supply or it may be generated on the rotor. Either way there are usually brushes and slip rings, if not for DC current, then for control of that current.

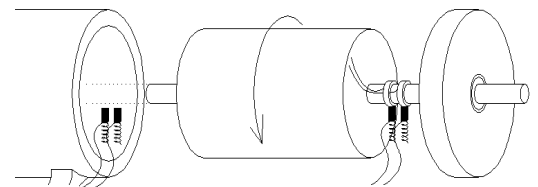

Slip rings and brushes used to connect a DC supply to the rotor. (brushes shown twice)

Synchronous Generators

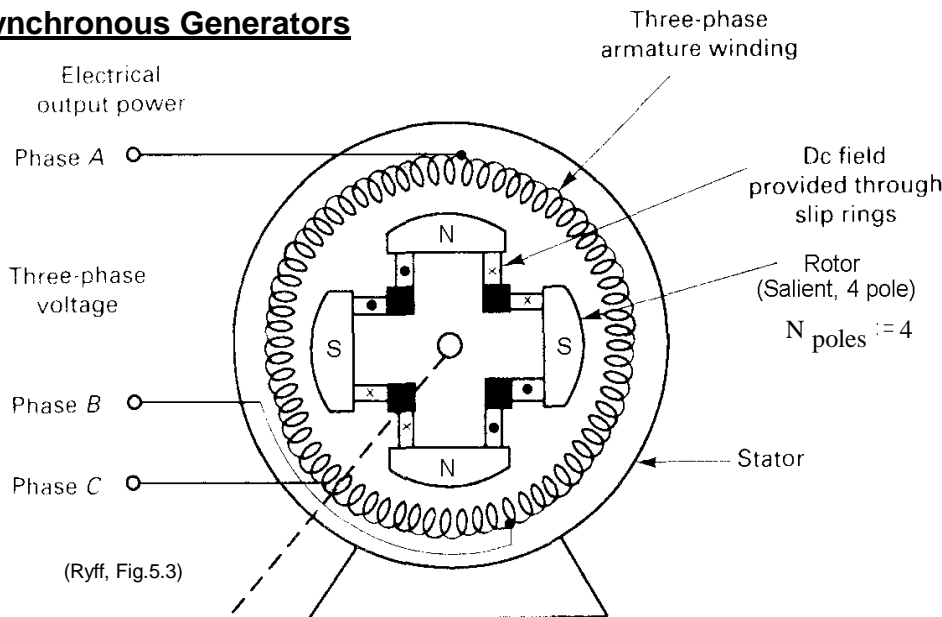


(Ryff, Fig.5.3)


Mechanical input power = Torque x ω
Prime mover (mechanical input power)

$$\omega = \frac{377 \cdot \text{rad}}{\text{sec}} = 188.5 \cdot \frac{\text{rad}}{\text{sec}}$$

$$n = \frac{7200 \cdot \text{rpm}}{4} = 1800 \cdot \text{rpm}$$

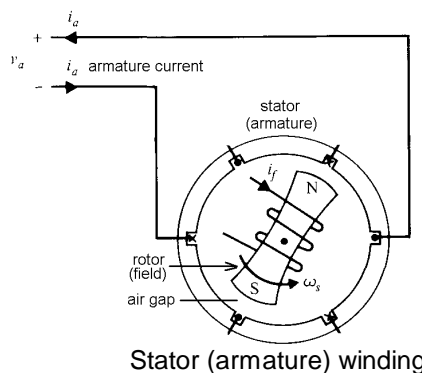


Stator (armature) winding

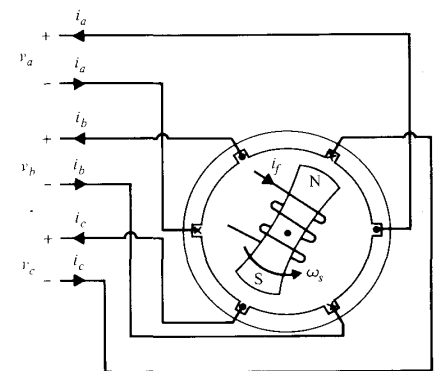

2-pole, 3-phase synchronous generator (Brown, Fig.4.1)

Electrical analysis on a per-phase basis

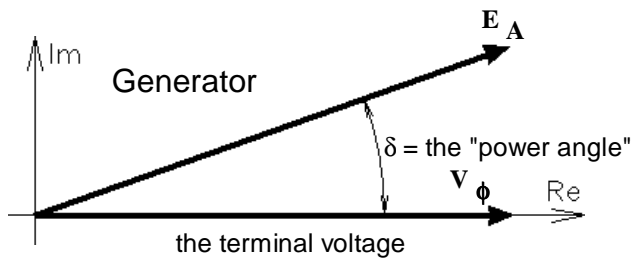


When operated as a generator, the induced armature voltage (E_A) leads the terminal voltage, V_ϕ .

The magnitude E_A depends on the DC field current, I_f .


The electrical model of an armature winding

X_s is the armature inductance
(armature windings and leakage)
(magnetization)

R_s is the armature winding resistance

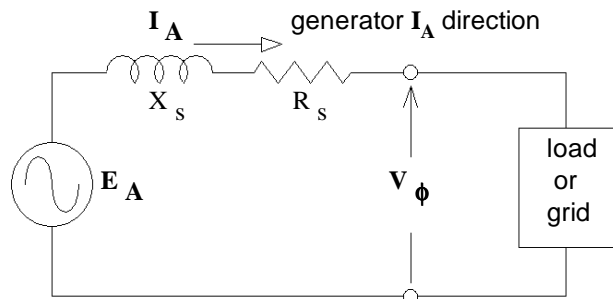

This is almost always simplified to this:
(Especially in our class)

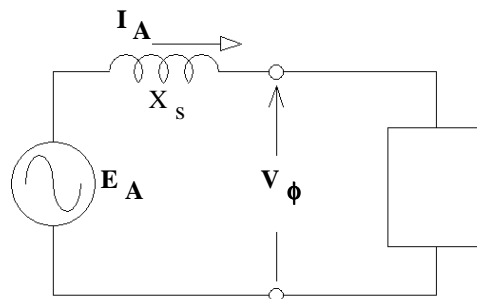


Low, or Under-excited

Low DC field current

Low E_A

Makes -Q

"Uses" Q like an
inductive load

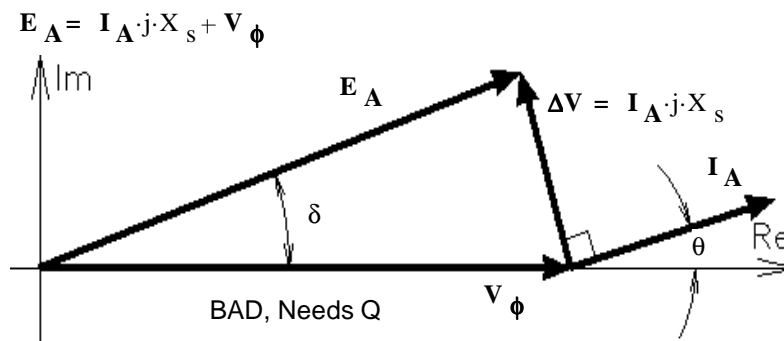


The **under-excited** condition, the current leads the terminal voltage, V_ϕ . The generator supplies -Q (-VARs), that is, it absorbs +Q (+VARs), just like an inductive load. Usually not desirable.

High, or Over-excited

Higher DC field current

High E_A

Makes Q

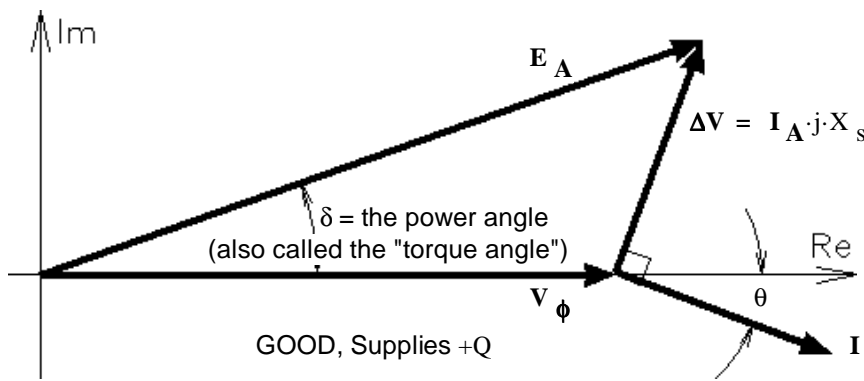



$$I_A = \frac{\Delta V}{j \cdot X_s} \text{ current lags, matching the need of most loads}$$

The **over-excited** condition, the current lags the terminal voltage, V_ϕ . The generator supplies +Q (+VARs), that is, it absorbs -Q (-VARs), just like a capacitive load. Usually desirable.

Important relations

Note: Voltages and currents are magnitudes, not complex numbers

 The **signs** of the angles are **important!**

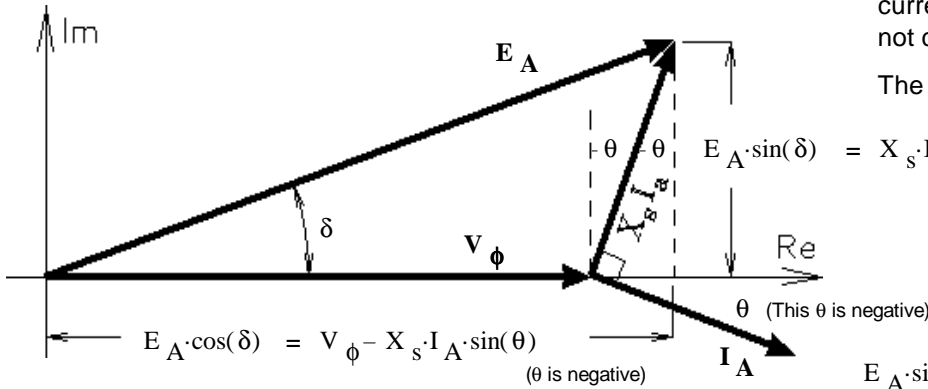

$$-I_A \sin(\theta) = \frac{E_A \cos(\delta) - V_\phi}{X_s}$$

$$E_A \sin(\delta) = X_s \cdot I_A \cos(\theta) \quad <----$$

$$I_A \cos(\theta) = \frac{E_A \sin(\delta)}{X_s}$$

$$Q_{1\phi} = -V_\phi \cdot I_A \cdot \sin(\theta)$$

$$P_{1\phi} = V_\phi \cdot I_A \cdot \cos(\theta)$$

$$----> \quad Q_{1\phi} = \frac{V_\phi \cdot E_A \cos(\delta) - V_\phi^2}{X_s}$$

$$P_{1\phi} = \frac{V_\phi \cdot E_A \sin(\delta)}{X_s} \quad <----$$

$$\delta = \text{asin}\left(\frac{P_{1\phi} \cdot X_s}{V_\phi \cdot E_A}\right) \quad <----$$

$$\text{asin} = \sin^{-1}$$

Pullout power

If δ reaches 90° , the generator will lose synchronization.

Pullout power is the maximum power a generator can produce for a given excitation, at $\delta := 90\text{-deg}$

$$P_{po} = \frac{E_A \cdot V_\phi}{X_s} \cdot \sin(90\text{-deg}) = \frac{E_A \cdot V_\phi}{X_s}$$

To Bring a Synchronous Generator "On Line"

1. Bring speed to the correct rpm so that the generator frequency matches the line frequency.
2. Adjust the field current, I_f so that the generator voltage matches the line voltage.
3. Readjust speed if necessary, check that the phases are in the correct sequence if necessary.
4. Wait until the phases align (0 volts difference between generator terminal and the line phase). Connect to the line at just the right moment.
5. Increase input torque to produce real electrical power and field current to produce reactive power.

Most (~99%) of the world's electrical energy is produced by 3-phase synchronous generators.

Mechanical speed, torque, and power




$$\text{Shaft speed in rad/sec} \quad \omega_{\text{mech}} = \frac{4 \cdot \pi \cdot f}{N_{\text{poles}}} = \frac{2 \cdot \left(377 \cdot \frac{\text{rad}}{\text{sec}}\right)}{N_{\text{poles}}} \quad \text{for 60Hz systems}$$

$$\text{Shaft speed in rev/min} \quad n = \frac{f \cdot \frac{2 \cdot \text{poles} \cdot 60 \cdot \text{sec}}{\text{cyc} \cdot \text{min}}}{N_{\text{poles}}} = \frac{7200 \cdot \text{rpm}}{N_{\text{poles}}} \quad \text{for 60Hz systems}$$

$$\tau_{\text{mech}} \cdot \omega_{\text{mech}} = P_{3\phi} \quad (\text{electrical}) \quad \text{neglecting losses}$$

$$\tau_{\text{mech}} = \text{mechanical torque}$$

Synchronous Motors

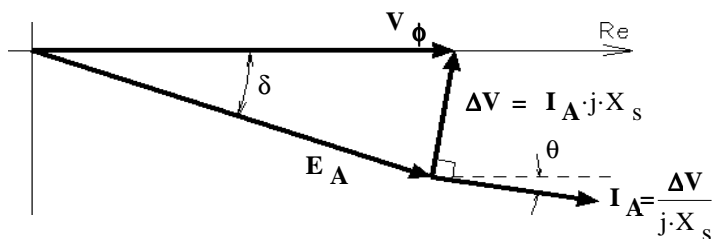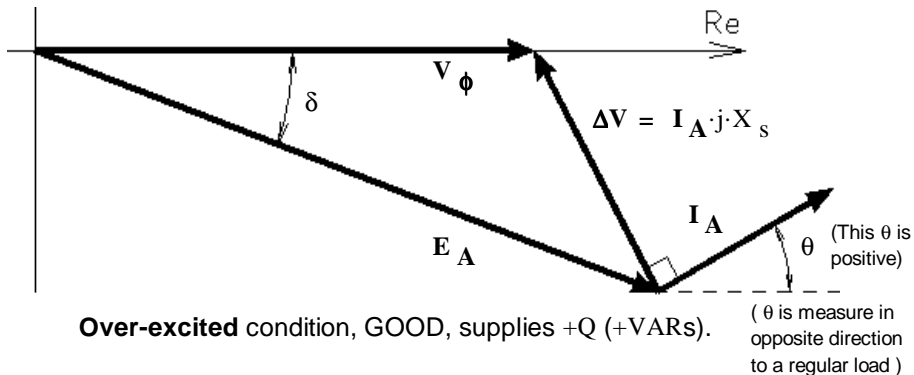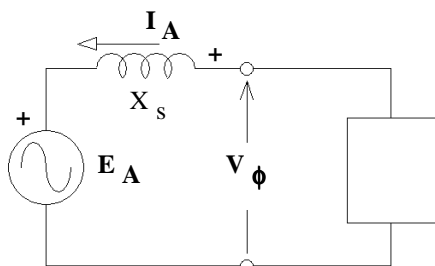

Under-excited condition, BAD, absorbs +Q (+VARs).

Important relations

$$Q = V_{\phi} \cdot I_A \cdot \sin(-\theta)$$

$$E_A \cdot \sin(|\delta|) = X_s \cdot I_A \cdot \cos(\theta)$$


$$P_{1\phi} = \frac{E_A \cdot V_{\phi} \cdot \sin(|\delta|)}{X_s}$$

$$Q_{1\phi} = \frac{V_{\phi}^2 - E_A \cdot V_{\phi} \cdot \cos(\delta)}{X_s} \quad (\text{Bigger } E_A \text{ makes } Q \text{ negative (good)})$$

Synchronous Condenser (Capacitor)

A special case of the over-excited motor with no mechanical load (and neglecting friction)




An under-excited motor with no mechanical load (and neglecting friction) will look like an inductor. Called synchronous reactance.

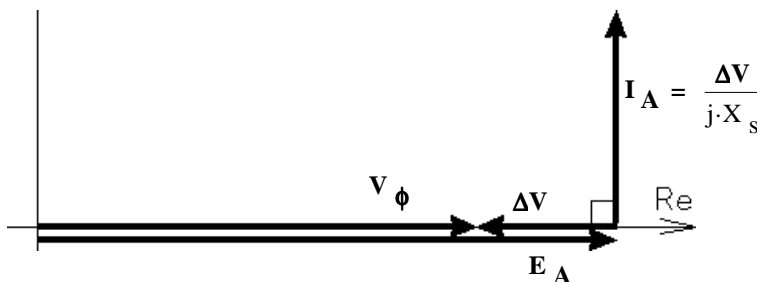

Motor Connections and Changing the Direction of Rotation

DO NOT alter the manufacturer's wiring within the motor, other than to change from Y to Δ or reverse. And then follow directions carefully. Otherwise something like this could happen:

It is OK to change the connections between the power panel and the motor as long as you don't mess with the neutral and/or ground connections. Swapping any two phases from the power panel will reverse the direction of rotation. Works for both Y and Δ connections

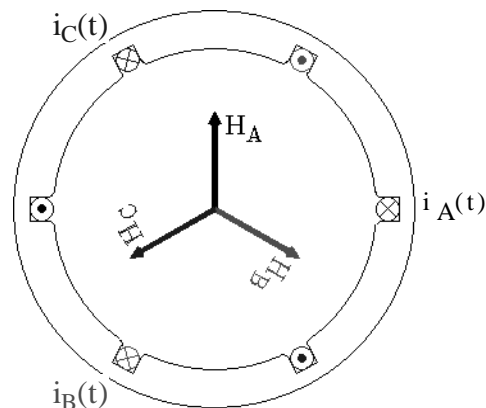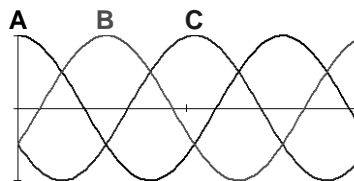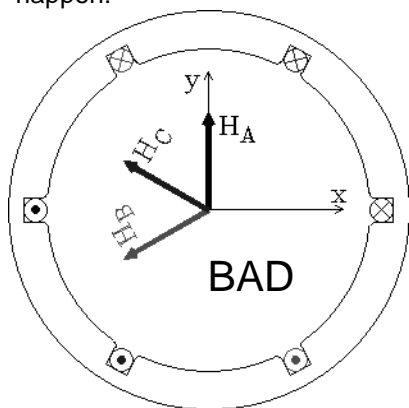

The 3 phases create a clockwise rotating magnetic field.

In steady-state synchronous operation, the rotor of a synchronous machine does not experience a changing magnetic flux so there are no core losses in the rotor and it can be made of solid ferromagnetic material. The stator, on the other hand, *does* experience a changing magnetic flux (at 60 Hz) so there are both hysteresis and eddy-current core losses in the stator. The stator is constructed of laminated, siliconized material to minimize the eddy currents.

Stator windings in practice


The nonlinearity of the stator core also causes the stator current to be nonsinusoidal, including a significant third-harmonic (just like in a transformer). To reduce the harmonics, the phase windings are designed to overlap each other a little and don't always span exactly 180° of flux.

Effect on the network (grid)

Our analysis regularly assumes that the generator feeds an "infinite" network bus. Then we can assume the network voltage, or the terminal voltage, is constant in magnitude, frequency and phase (The slack-bus idea). In reality, large generators *do* affect the network (the larger the generator, the larger the effect). Increasing the prime-mover torque will raise the network voltage (especially in the local area) and slightly increase the entire network frequency. Matching the generation of reactive power to the local needs will help to optimize the network power flow.

Damper Bars


The rotor of an induction motor includes a number of thick conductors called "rotor bars". Current is induced in these bars because the rotor normally turns at speed which is slower than the synchronous speed (the speed of the rotating flux caused by the stator windings). The interaction between the induced current and the rotating flux provides the motor torque.

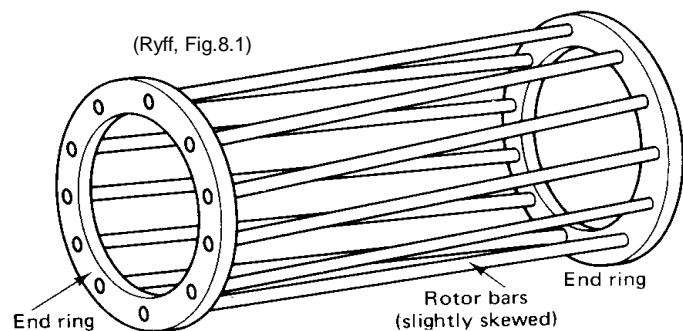


Synchronous machines usually have very similar bars in their rotors. In steady-state synchronous operation, they have no effect. The purpose of these bars is to resist, or dampen, transients. Currents will be induced in these windings when the stator current magnitudes change or when the input rotational shaft speed changes. By Lenz's law, those currents will be induced in a direction to oppose the change that caused them. In solid iron rotors, the eddy currents have the same effect. Without damping, the shaft speed can oscillate.

See textbook section 5.11, p.243 for more details.

See also textbook
fig 5.41, p.245

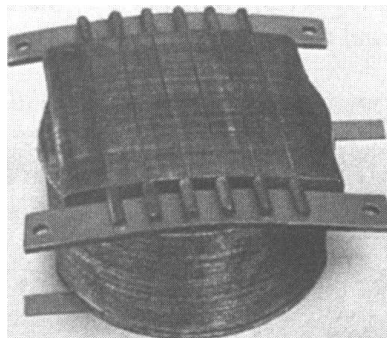

(Ryff, Fig.10.3)

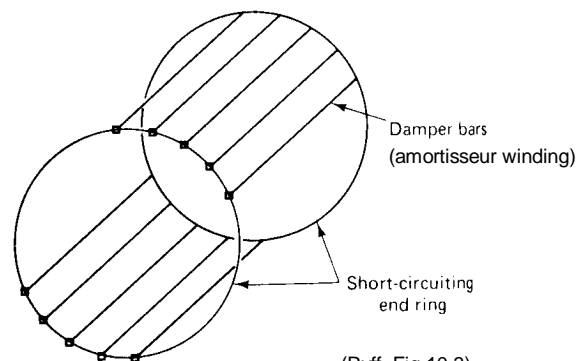

(Ryff, Fig.10.3)

Note: These notes and Chapter 5 of our textbook assumes that the DC supply of the field current is robust enough to withstand high voltage transients. It also assumes the source resistance and the field winding resistance are so small that the field winding itself can perform the transient damping function. It is more reasonable to assume that the synchronous machine is constructed with damper bars, but the results of the different assumptions is about the same.

ECE 3600 Synchronous Generator & Motor Examples

Ex. 1 (F08 E2) A 60 Hz, 4-pole, 3-phase, Y connected synchronous generator supplies 90 kW of power to a 4 kV bus. The synchronous reactance is 50 Ω/phase. The generator emf is 3 kV. Find the following.


a) The power angle, δ . given $N_{\text{poles}} := 4$ $f := 60\text{-Hz}$ $P_{3\phi} := 90\text{-kW}$ $X_s := 50\text{-}\Omega$ $E_A := 3\text{-kV}$ $V_\phi := \frac{4\text{-kV}}{\sqrt{3}}$

$$P_{1\phi} := \frac{P_{3\phi}}{3} \quad P_{1\phi} = 30\text{-kW} = \frac{V_\phi \cdot E_A \cdot \sin(\delta)}{X_s} \quad \delta := \text{asin}\left(\frac{P_{1\phi} \cdot X_s}{V_\phi \cdot E_A}\right) \quad \delta = 12.5\text{-deg}$$

b) The total reactive power generated.

$$Q_{1\phi} = \frac{V_\phi \cdot E_A \cdot \cos(\delta) - V_\phi^2}{X_s} \quad Q_{3\phi} = 3 \cdot \frac{V_\phi \cdot E_A \cdot \cos(\delta) - V_\phi^2}{X_s} = 85.83\text{-kVAR}$$

c) Find a new magnitude of the generator emf so that $Q := 45\text{-kVAR}$

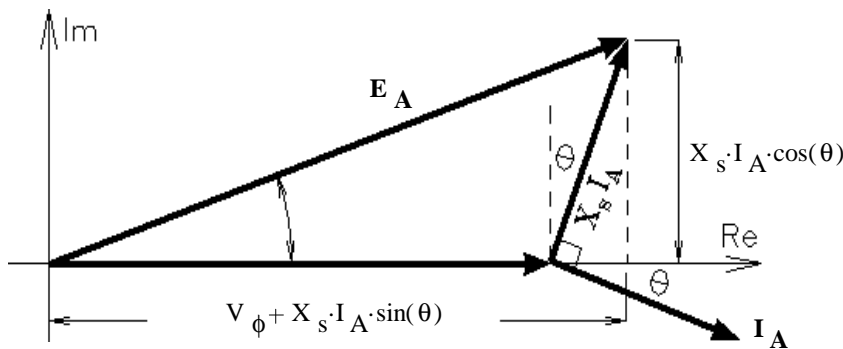

$$Q_{1\phi} := \frac{Q}{3} \quad S_{1\phi} := \sqrt{P_{1\phi}^2 + Q_{1\phi}^2}$$

$$I_A := \frac{S_{1\phi}}{V_\phi} \quad I_A = 14.52\text{-A}$$

$$\theta := \text{atan}\left(\frac{Q_{1\phi}}{P_{1\phi}}\right) \quad \theta = 26.57\text{-deg}$$

Notice that θ is positive in the downward direction, contrary to the notes. Also notice how that affects the figure at left. Know what you're doing, don't just use formulas!

by Pythagorean theorem: $E_A := \sqrt{(V_\phi + X_s \cdot I_A \cdot \sin(\theta))^2 + (X_s \cdot I_A \cdot \cos(\theta))^2}$ $E_A = 2.713\text{-kV}$

Alternatively, by complex numbers: $\Delta V := I_A \cdot X_s \cdot e^{j(90\text{-deg} - \theta)}$ $E_A := V_\phi + \Delta V \quad |E_A| = 2.713\text{-kV}$

$$\delta = \arg(E_A) = 13.851\text{-deg}$$

d) The shaft speed. $n := \frac{7200\text{-rpm}}{N_{\text{poles}}} \quad n = 1800\text{-rpm}$ $\omega_m := n \cdot \frac{2\pi\text{-rad}}{\text{rev}} \cdot \left(\frac{\text{min}}{60\text{-sec}}\right) \quad \omega_m = 188.496\text{-rad/sec}$

OR $\omega_m = \frac{2 \cdot \left(377\text{-rad/sec}\right)}{N_{\text{poles}}} = 188.5\text{-rad/sec}$

e) The shaft torque.

Often called the "Prime-mover torque"

$$P_{3\phi} = \omega \cdot \tau \quad \tau := \frac{P_{3\phi}}{\omega_m} \quad \tau = 477.5\text{-N}\cdot\text{m}$$

f) The shaft torque is decreased to half the value found in part e). What is the new P and Q?

$$P'_{1\phi} := \frac{1}{2} \cdot P_{1\phi} \quad P'_{1\phi} = 15\text{-kW} \quad \delta := \text{asin}\left(\frac{P'_{1\phi} \cdot X_s}{V_\phi \cdot E_A}\right) \quad \delta = 6.87\text{-deg}$$

$$Q_{3\phi} = 3 \cdot \frac{V_\phi \cdot E_A \cdot \cos(\delta) - V_\phi^2}{X_s} = 53.23\text{-kVAR}$$


Ex. 2

A 60 Hz, 2-pole, Y-connected, 3-phase synchronous generator supplies 15 MW of power to a 18 kV bus. The synchronous reactance is 6 Ω/phase. The magnitude of the generator emf equals the magnitude of the bus voltage.

givens $V_\phi := \frac{18\text{-kV}}{\sqrt{3}}$ $V_\phi = 10.392 \cdot \text{kV}$ $X_s := 6 \cdot \Omega$ $P_{1\phi} := \frac{15\text{-MW}}{3}$ $P_{1\phi} = 5 \cdot \text{MW}$
 $E_A := V_\phi$

Find:
 a) The power angle, δ . $P_{1\phi} = \frac{E_A \cdot V_\phi}{X_s} \cdot \sin(\delta)$ $\delta := \text{asin}\left(\frac{P_{1\phi} \cdot X_s}{E_A \cdot V_\phi}\right)$ $\delta = 16.13 \cdot \text{deg}$

b) The complex phase current, (Assume the bus voltage phase angle is 0°).

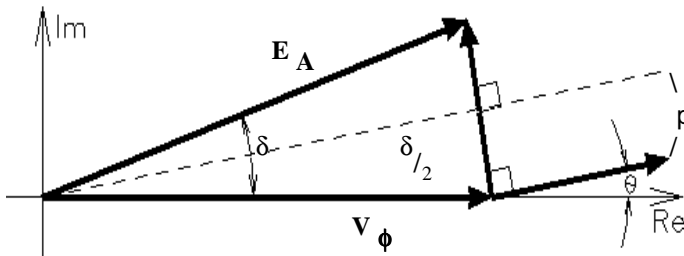

$\theta := \frac{\delta}{2}$ $\theta = 8.06 \cdot \text{deg}$ lead

$P_{1\phi} = V_\phi \cdot I_A \cdot \cos(\theta)$

$I_A := \frac{P_{1\phi}}{V_\phi \cdot \cos(\theta)}$ $I_A = 485.9 \cdot \text{A}$ 8.06°

c) The magnitude and direction of reactive power.

$Q_{3\phi} := 3 \cdot V_\phi \cdot I_A \cdot \sin(-\theta)$

$Q_{3\phi} = -2.125 \cdot \text{MVAR}$

Since the current leads the voltage, this generator absorbs reactive power (produces -VARs)

Ex. 3

A 60-Hz, three-phase, 6-pole, Δ-connected synchronous motor is connected to 480 V and produces 80 hp. The motor draws minimum current with an excitation voltage of $E_A = 520$ V per phase. Mechanical losses are 5 hp .

givens $N_{\text{poles}} := 6$ $V_\phi := 480 \cdot \text{V}$ $P_{3\phi} := 80\text{-hp} + 5\text{-hp}$ $E_A := 520 \cdot \text{V}$

Determine the following:


$P_{1\phi} := \frac{85\text{-hp} \cdot 745.7\text{-W}}{3 \text{ hp}}$ $P_{1\phi} = 21.1 \cdot \text{kW}$

a) The current.

Minimum current implies $\text{pf} := 1$ so...

$I_A := \frac{P_{1\phi}}{V_\phi}$ $I_A = 44.02 \cdot \text{A}$

b) The line current. $I_L := \sqrt{3} \cdot I_A$ $I_L = 76.24 \cdot \text{A}$

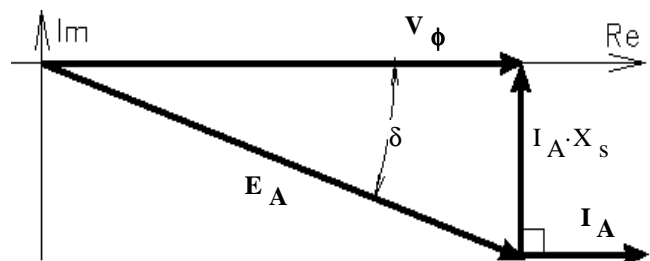

c) The synchronous reactance.

by Pythagorean theorem: $I_A \cdot X_s = \sqrt{E_A^2 - V_\phi^2}$

$X_s := \frac{\sqrt{E_A^2 - V_\phi^2}}{I_A}$ $X_s = 4.544 \cdot \Omega$

d) The torque.

$\omega_{\text{mech}} := \frac{4 \cdot \pi \cdot f}{N_{\text{poles}}}$

$\tau_{\text{mech}} = \frac{80\text{-hp} \cdot \frac{745.7\text{-W}}{\text{hp}}}{\omega_{\text{mech}}} = 475 \cdot \text{N}\cdot\text{m}$

e) The rotor power angle.

$\delta = \text{acos}\left(\frac{V_\phi}{E_A}\right) = 22.62 \cdot \text{deg}$

f) The maximum power this motor could provide at this excitation voltage.

$\delta := 90\text{-deg}$ $P_{3\phi} = 3 \cdot \frac{E_A \cdot V_\phi}{X_s} \cdot \sin(\delta) \cdot \frac{1\text{-hp}}{745.7\text{-W}} - 5\text{-hp} = 216 \cdot \text{hp}$

Note: The current rating of the motor may be exceeded at this load.

Ex. 4

(F09 Fin) You make the following measurements on a 3-phase, Y-connected, synchronous generator.


$P_{3\phi} := 120 \cdot \text{kW}$
 $V_{LL} := 480 \cdot \text{V}$
 $I_L := 160 \cdot \text{A}$
 $X_s := 1.2 \cdot \Omega$

Unfortunately, you don't know the phase angle of current.

a) Draw a phasor diagram of one of the two possible interpretations of these numbers.

Find the induced armature voltage (E_{af}) and the power angle, δ . $E_A = ?$ $\delta = ?$

My first assumption:

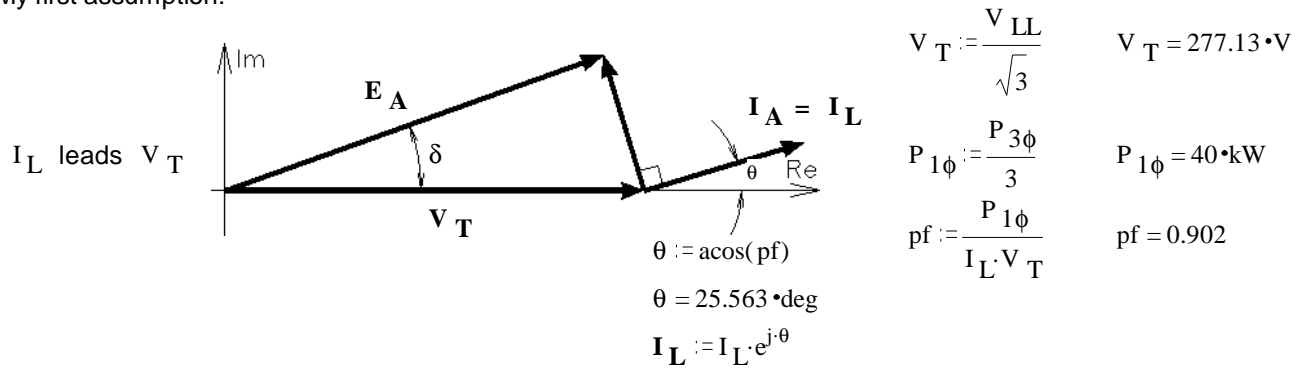


$E_A := V_T + I_L \cdot (j \cdot X_s)$
 $E_A = |E_A| = 260.28 \cdot \text{V}$
 $\delta = \arg(E_A) = 41.718 \cdot \text{deg}$

b) Draw a phasor diagram of other possible interpretation of these numbers.

Find the induced armature voltage (E_{af}) and the power angle, δ . $\delta = ?$

My second assumption:

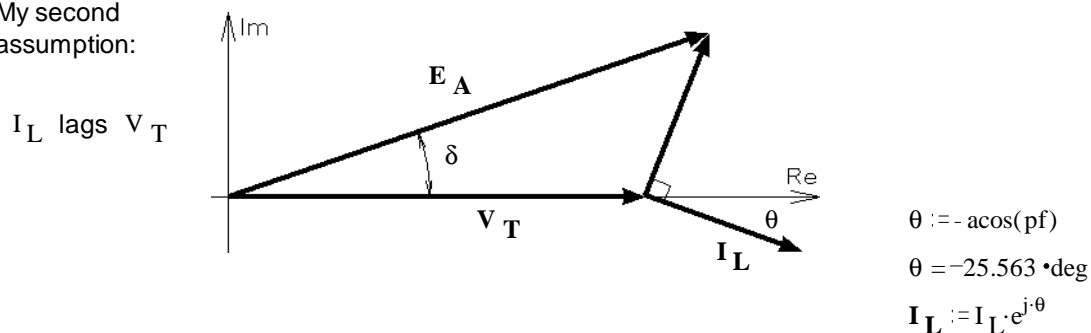

$E_A := V_T + I_L \cdot (j \cdot X_s)$
 $E_A = |E_A| = 399.48 \cdot \text{V}$
 $\delta = \arg(E_A) = 25.695 \cdot \text{deg}$

c) A traveling carnival uses a combination of this generator and the local power company to run its load, mainly induction motors. When the generator is connected to the carnival's power distribution network, it supplies half of the required power, but the current from the power company only decreases by about 30%. Which of the calculations above is most likely correct?

Assumption in a)

Give me the reasoning behind your answer (no calculations required).

The induction motors represent a lagging pf load, they use lots of VARs. If the local generator were supplying those VARs, then the current would go down by about half and quite possibly more. The small reduction in current implies that the generator also consumes VARs (creates negative VARs). That is condition a).

d) What do you change at the generator to reduce the current flow from the power company?

Tell me what you adjust and if you turn it up or down.

Turn up the field current.

Ex. 5

ECE 3600 Synchronous Mach. Examples p4

(F09 E2, p4) An industrial plant is powered from a 480-V, 3-phase bus and currently draws 60 kW at a power factor of 0.8 lagging. A new mill is to be added at the plant. This mill requires a shaft torque of 600 Nm at 1200 rpm. Your job is to specify a motor which will run the mill and correct the plant power factor at the same time. Be sure to specify the type of motor including the number of poles. Tell me how the motor should be connected to the bus (This is an arbitrary decision here, but it will affect many of your other answers). Specify its minimum hp, voltage, and current ratings. Tell me what the back emf should be. You may assume the synchronous reactance is 1 Ω/phase and that losses are negligible.

$$P_{3\phi} := 60 \cdot \text{kW} \quad P_{1\phi} := \frac{P_{3\phi}}{3} \quad P_{1\phi} = 20 \cdot \text{kW} \quad 1 \cdot \text{hp} = 745.7 \cdot \text{W}$$

$$\text{pf} := 0.8 \quad S_{1\phi} := \frac{P_{1\phi}}{\text{pf}} \quad S_{1\phi} = 25 \cdot \text{kVA} \quad Q_{1\phi} := \sqrt{S_{1\phi}^2 - P_{1\phi}^2} \quad Q_{1\phi} = 15 \cdot \text{kVAR}$$

$$N_{\text{poles}} := \frac{7200}{1200} \quad N_{\text{poles}} = 6 \quad \omega_{\text{mech}} := \frac{4 \cdot \pi \cdot f}{N_{\text{poles}}} \quad \omega_{\text{mech}} = 125.7 \cdot \frac{\text{rad}}{\text{sec}} \quad \left(\frac{377}{3} \right)$$

Use a 6-pole synchronous motor

$$\tau_{\text{mech}} := 600 \cdot \text{N} \cdot \text{m} \quad \text{motor power} = P_{m3\phi} = \tau_{\text{mech}} \cdot \omega_{\text{mech}} = 75.398 \cdot \text{kW}$$

$$\tau_{\text{mech}} \cdot \omega_{\text{mech}} \cdot \frac{1 \cdot \text{hp}}{745.7 \cdot \text{W}} = 101.111 \cdot \text{hp} = \text{min hp rating}$$

$$P_{m1\phi} := \frac{\tau_{\text{mech}} \cdot \omega_{\text{mech}}}{3} \quad P_{m1\phi} = 25.133 \cdot \text{kW}$$

To fix the plant pf, $Q_{m1\phi} := -Q_{1\phi} \quad Q_{m1\phi} = -15 \cdot \text{kVAR}$

If you select Y-connected $V_{\phi} := \frac{480 \cdot \text{V}}{\sqrt{3}} \quad V_{\phi} = 277.1 \cdot \text{V} = \text{min voltage rating}$

Current per phase: $I := \frac{\sqrt{P_{m1\phi}^2 + Q_{m1\phi}^2}}{V_{\phi}} \quad I = 105.61 \cdot \text{A} = \text{min current rating}$

Phase angle of the current: $\theta := \text{atan}\left(\frac{-Q_{m1\phi}}{P_{m1\phi}}\right) \quad \theta = 30.83 \cdot \text{deg}$

$X_s := 1 \cdot \Omega \quad \Delta V := I \cdot e^{j\theta} \cdot X_s \cdot j \quad \Delta V = -54.127 + 90.69j \cdot \text{V}$

motor back emf $E_A := V_{\phi} - \Delta V \quad E_A = 331.255 - 90.69j \cdot \text{V}$

$$|E_A| = 343.44 \cdot \text{V} = \text{required motor emf}$$

If you select Δ-connected $V_{\phi} := 480 \cdot \text{V} \quad V_{\phi} = 480 \cdot \text{V} = \text{min voltage rating}$

Current per phase: $I := \frac{\sqrt{P_{m1\phi}^2 + Q_{m1\phi}^2}}{V_{\phi}} \quad I = 60.98 \cdot \text{A} = \text{min current rating}$


$X_s := 1 \cdot \Omega \quad \Delta V := I \cdot e^{j\theta} \cdot X_s \cdot j \quad \Delta V = -31.25 + 52.36j \cdot \text{V}$

motor back emf $E_A := V_{\phi} - \Delta V \quad E_A = 511.25 - 52.36j \cdot \text{V}$

$$|E_A| = 513.92 \cdot \text{V} = \text{required motor emf}$$


1. A single-phase generator delivers a voltage of 680 V rms at its terminals and a current of 32 A rms. The real power delivered is 15 kW. Find the reactive power Q. Give both possible answers.
2. A 3-phase synchronous generator operates onto a grid bus of voltage 12 kV (line value). The synchronous reactance is 5 Ω/phase. The magnitude of the generator emf equals the magnitude of the bus voltage. The machine delivers 18 MW to the grid. Find:
 - a) The power angle, δ.
 - b) The complex phase current, (Assume the bus voltage phase angle is 0°).
 - c) The magnitude and direction of reactive power.
3. A 60 Hz, 2-pole, 3-phase synchronous generator supplies power to a 12.5 kV bus. The synchronous reactance is 4 Ω/phase. The generator emf is 7 kV /20° (the angle is referenced to the terminal voltage). Find the following.
 - a) The total power generated.
 - b) The total reactive power generated.
 - c) The shaft torque from the prime mover, neglecting friction.
 - d) Increase the magnitude of the generator emf so that Q := 0·VAR. The prime mover torque does not change. Note: If the prime mover torque doesn't change, neither does P. δ can change.
 - e) The new power angle, δ.
 - f) Increase the magnitude of the generator emf so that Q := 9·MVAR
 - g) The new power angle, δ.

4. 4.39 Refer to the per-phase phasor diagram at right. It is for a 12-pole, three-phase synchronous machine.
 - a) Is the machine operating as a motor or a generator?
 - b) What is the voltage and apparent power into/out of the machine?
 - c) Determine the synchronous reactance of the machine.
 - d) For the same real power, what magnitude of excitation voltage yields unity power factor?

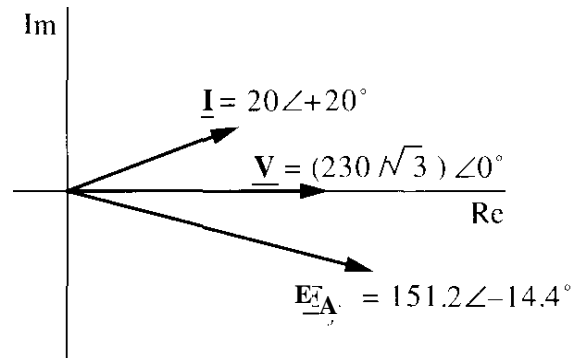

5. 4.41. A cylindrical-rotor, 60-Hz, three-phase, 12-pole synchronous motor operates from 2300 V and produces 500 hp. The motor operates with unity power factor with an excitation voltage of E = 1620 V per phase. Neglect losses. Determine the following:
 - a) The current.
 - b) The synchronous reactance.
 - c) The torque.
 - d) The rotor power angle.

6. 4.43. The per-phase phasor diagram for a three-phase, 60-Hz, 8-pole synchronous motor is shown. Note that all sides and two angles of the triangle are shown. The current/phase is 21 A
 - a) Is the motor overexcited or underexcited?
 - b) What is the rotor power angle?
 - c) What is the power factor and is it leading or lagging?
 - d) Determine the synchronous reactance per phase.
 - e) Determine the output power and torque, neglecting mechanical losses.

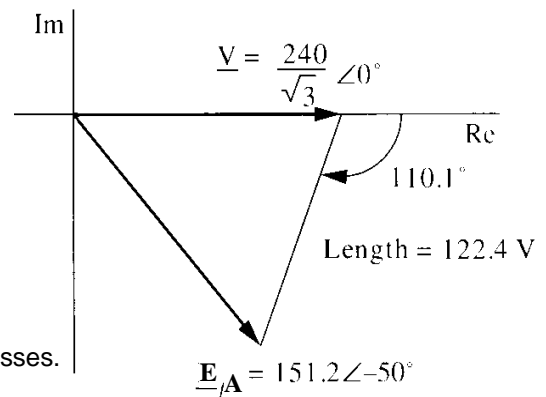


Answers

1. ± 15.8 kVAR 2. a) 38.68·deg b) 918·A / 19.34·deg c) -6.32·MVAR
3. a) 12.96·MW b) -3.459·MVAR c) 3.437·10⁴·N·m d) 7.604·kV e) 18.35·deg f) 9.197·kV g) 15.1·deg
4. a) motor b) 132.8·V 7.97·kVA c) 2·Ω d) E_A = 138·V
5. a) 93.6·A b) 9.92·Ω c) 5934·N·m d) 34.95·deg
6. a) underexcited b) -50·deg c) 0.939 lagging d) 5.83·Ω e) 11·hp 87·N·m

- A 60 Hz, 4-pole, 3-phase synchronous generator supplies 90 kW of power to a 4-kV bus. The synchronous reactance is 50 Ω/phase. The generator emf is 3 kV. Find the following.


 - The power angle, δ .
 - The total reactive power generated.
 - Find a new magnitude of the generator emf so that $Q := 45\text{-kVAR}$
- You are operating gas-fired, 4-pole, 3-phase synchronous generation plant which supplies power to a 12.5-kV bus. The dispatcher asks for 36 MW and 24 MVAR. The synchronous reactance is 3 Ω/phase.

 - Find the required magnitude of the generator emf.
 - What do you adjust to achieve the required power output?
 - What do you adjust to achieve the required reactive power output?
 - Natural gas costs about \$5 per decatherm (ten therm) or MMBtu (one million BTU). A therm is approximately equivalent to 100 cubic feet of gas. A BTU is equal to 1055 joules. Your plant is 37% efficient. How much natural gas are you consuming per hour (in cubic feet)?
 - How much are you spending on natural gas per hour? Per day?
 - How much heat energy must you get rid of every hour?
 - According to the Pacific Gas and Electric Company emissions rate, burning natural gas produces on average 13.446 pounds (6.099 kg) of carbon dioxide per therm. How many pounds of CO₂ are you producing each hour?
- A synchronous generator and a synchronous motor are hooked to a bus which is also hooked to the power company's network, as shown. Phasor diagrams for each are also shown as well as each power. The input power from the prime mover to the generator is constant. The motor runs a pump which pumps water up to a water tower.

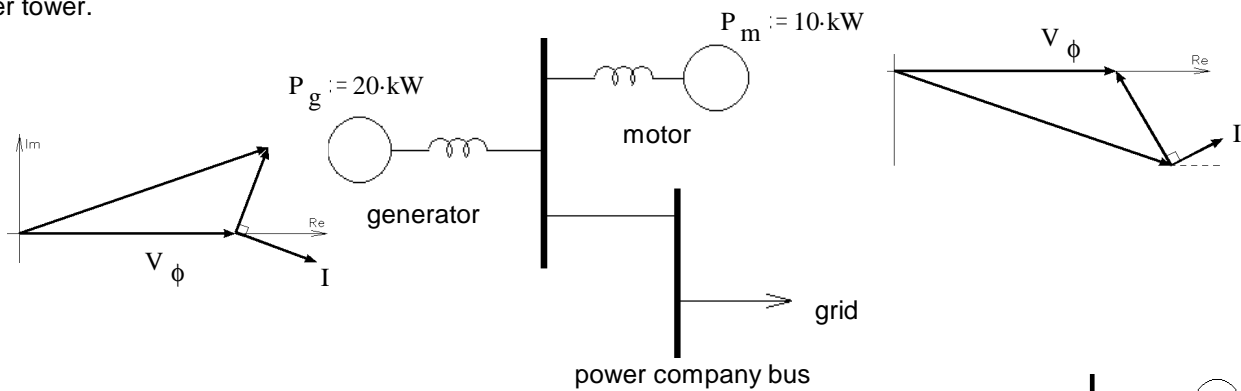

One day the connection to the power company is lost. Note: In order to answer the following questions, you may have to abandon some assumptions that you normally make.

- What will instantly change to rebalance the system? Draw one or more phasor diagrams to show how the currents (including phase angle) and powers now balance.
- What happens to the "extra" power.
- What else will change to rebalance the system at a new steady-state? List at least two major things (they are very closely related) that will change. Tell me which way they will change and how that makes the system balance.

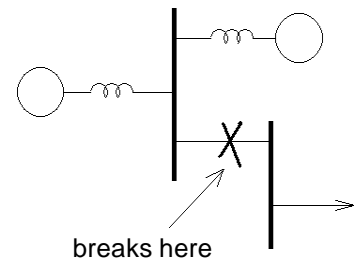

Answers

- 12.5-deg
 - 85.8-kVAR
 - 2713-V
 - 11.663-kV
 - The gas feed to the boiler.
- c) Field current to the rotor d) 332010 e) \$1660 \$39840
- f) $2.09 \cdot 10^8 \cdot \text{BTU}$ e) 44642

3. I want you to *think* about the questions. Then we'll discuss it in class, if someone asks.